



Servomotori asincroni MCA

Curve di coppia

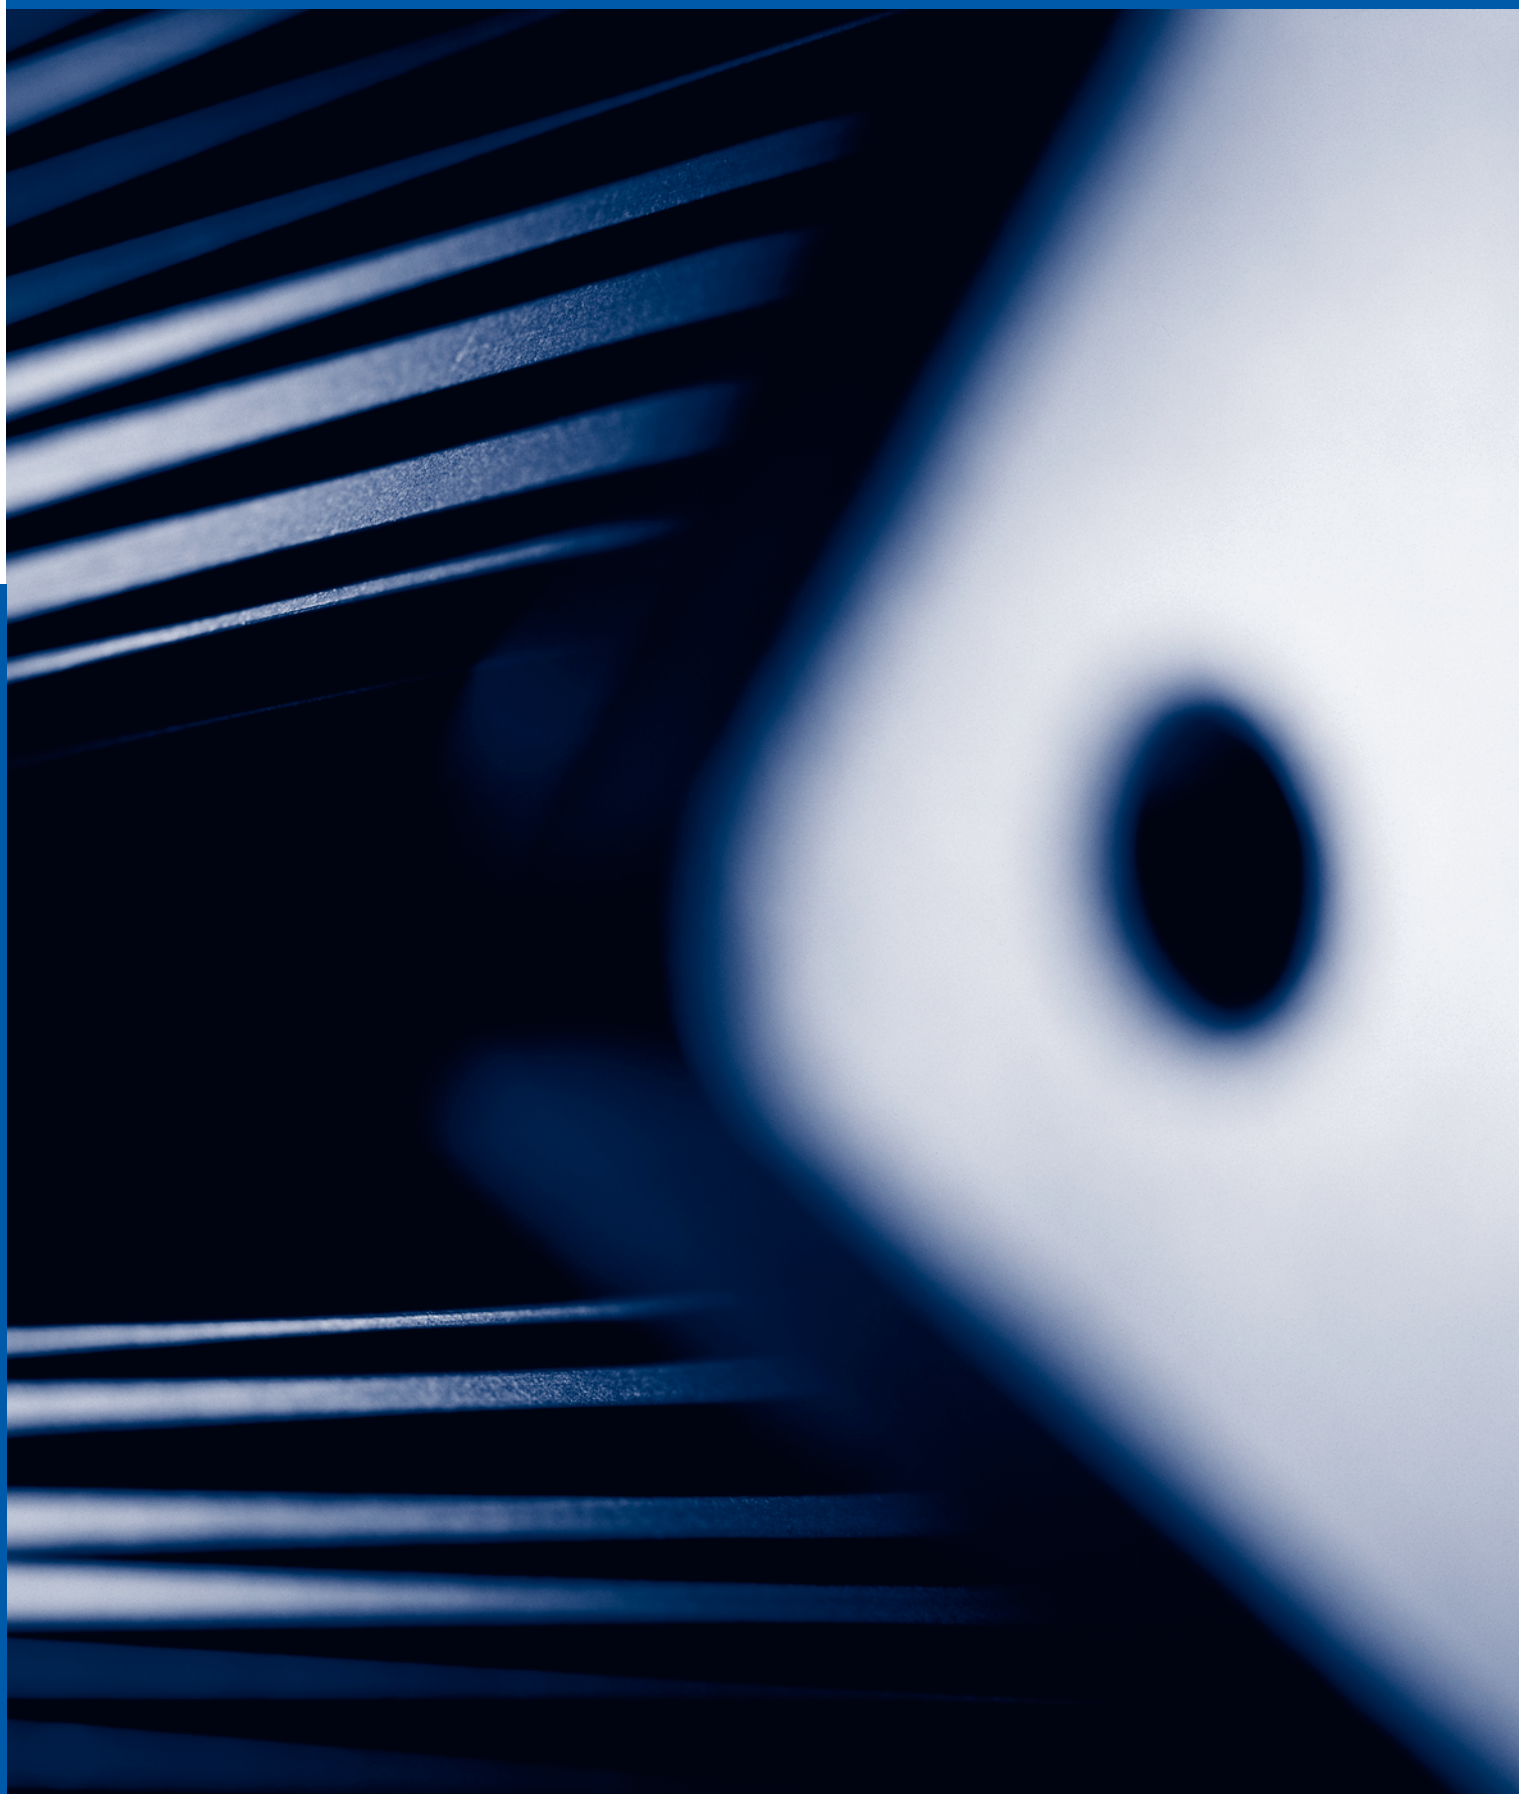

Torque characteristics


MCA 10I40...S00

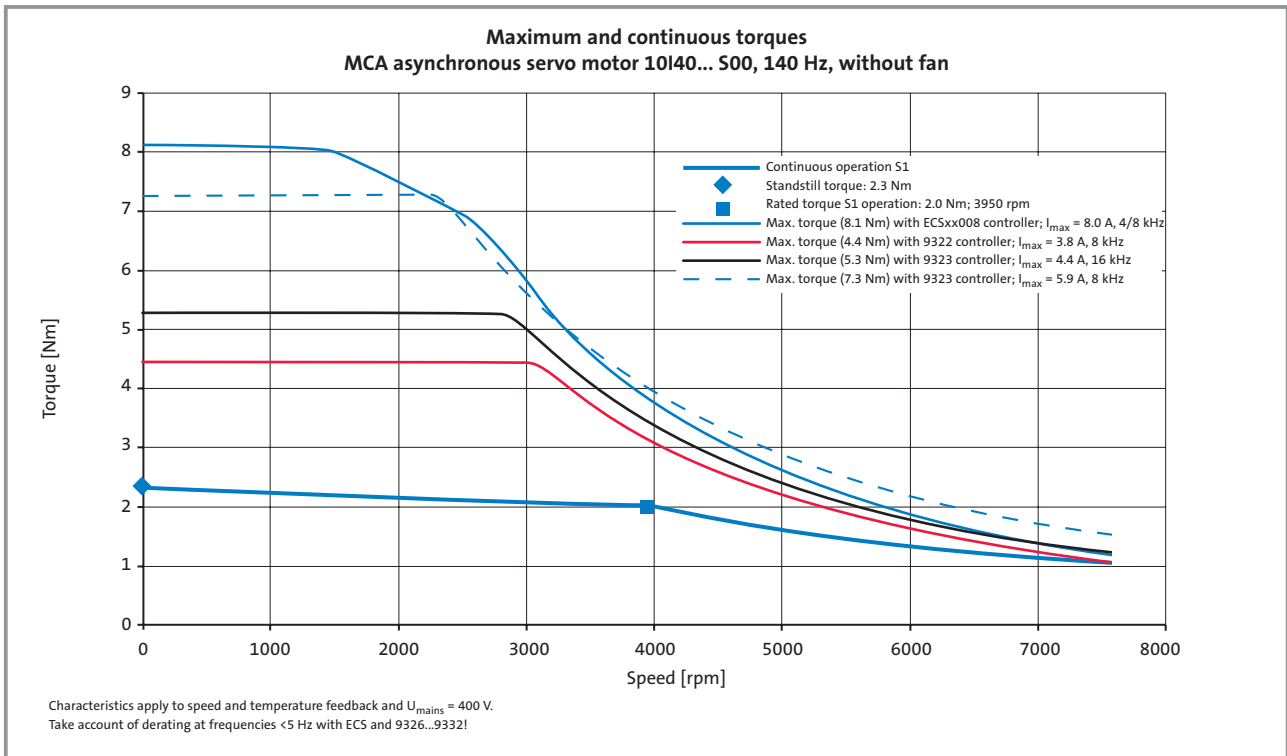




Torque characteristics

MCA 13I41...S00

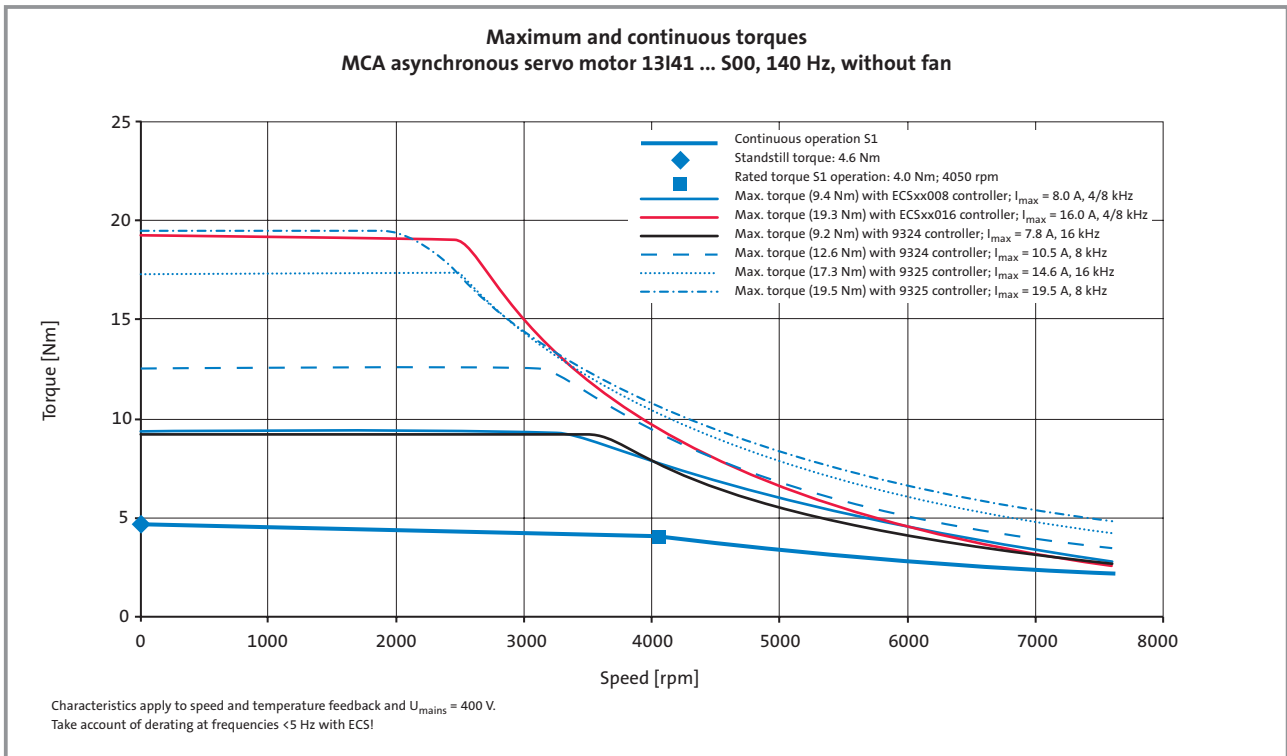


MCA 13I34...F10


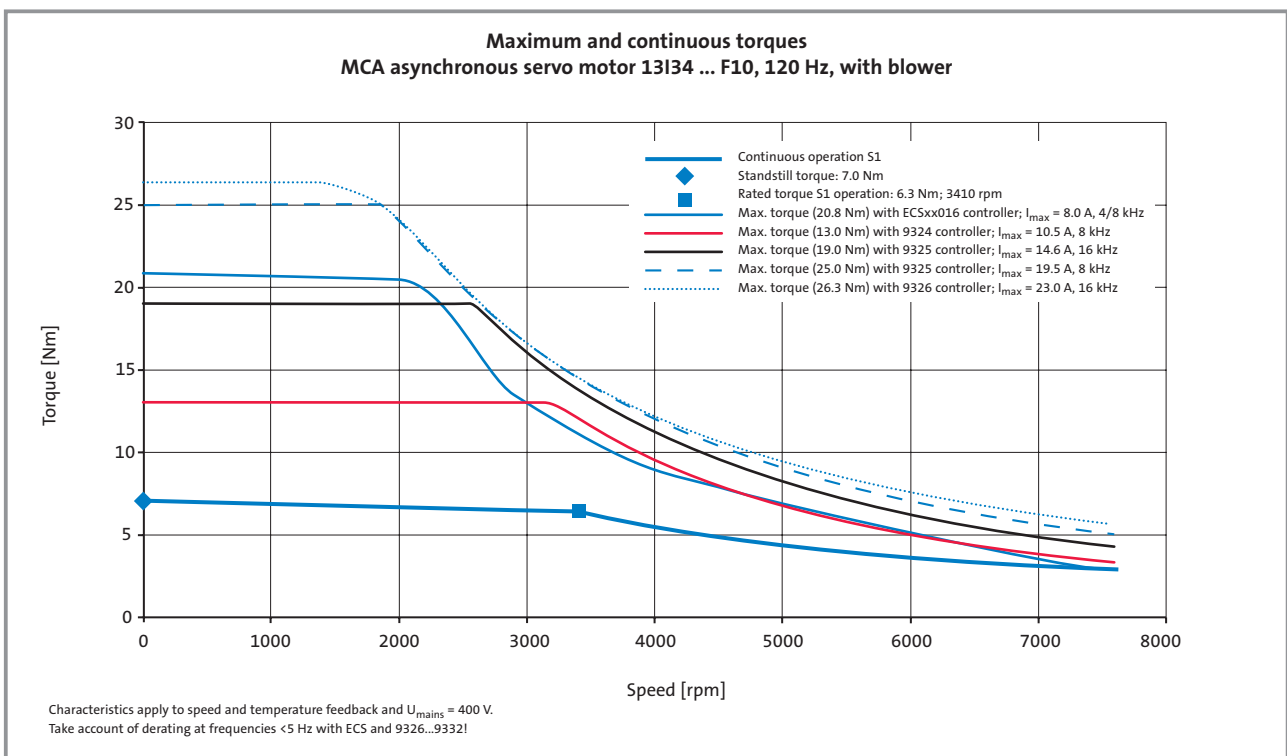


Short-time operation characteristic

Lenze MCA servo motors have high torque peaks. In order to make full use of this highly dynamic response as simply as possible, the following diagrams for operating modes S2


and S6 illustrate the permissible operating times against the torque peaks required.

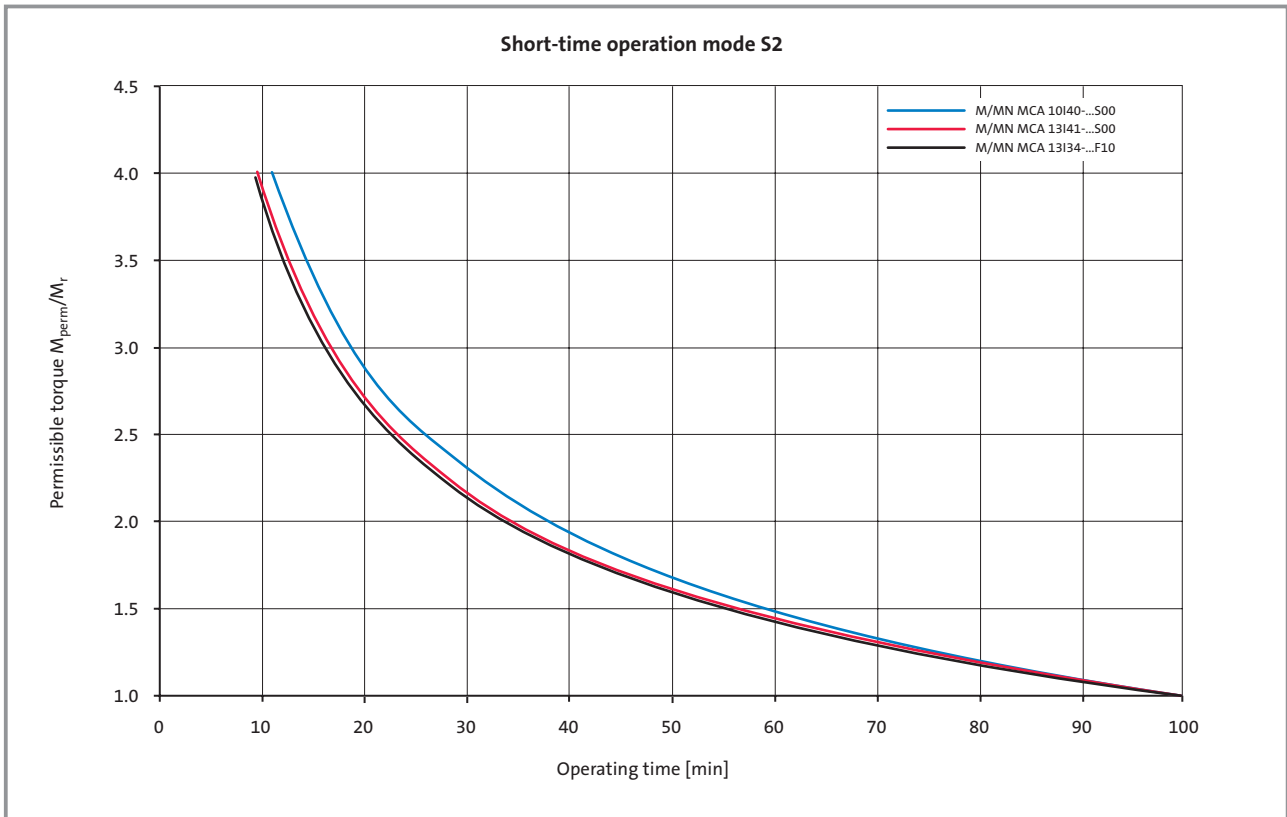

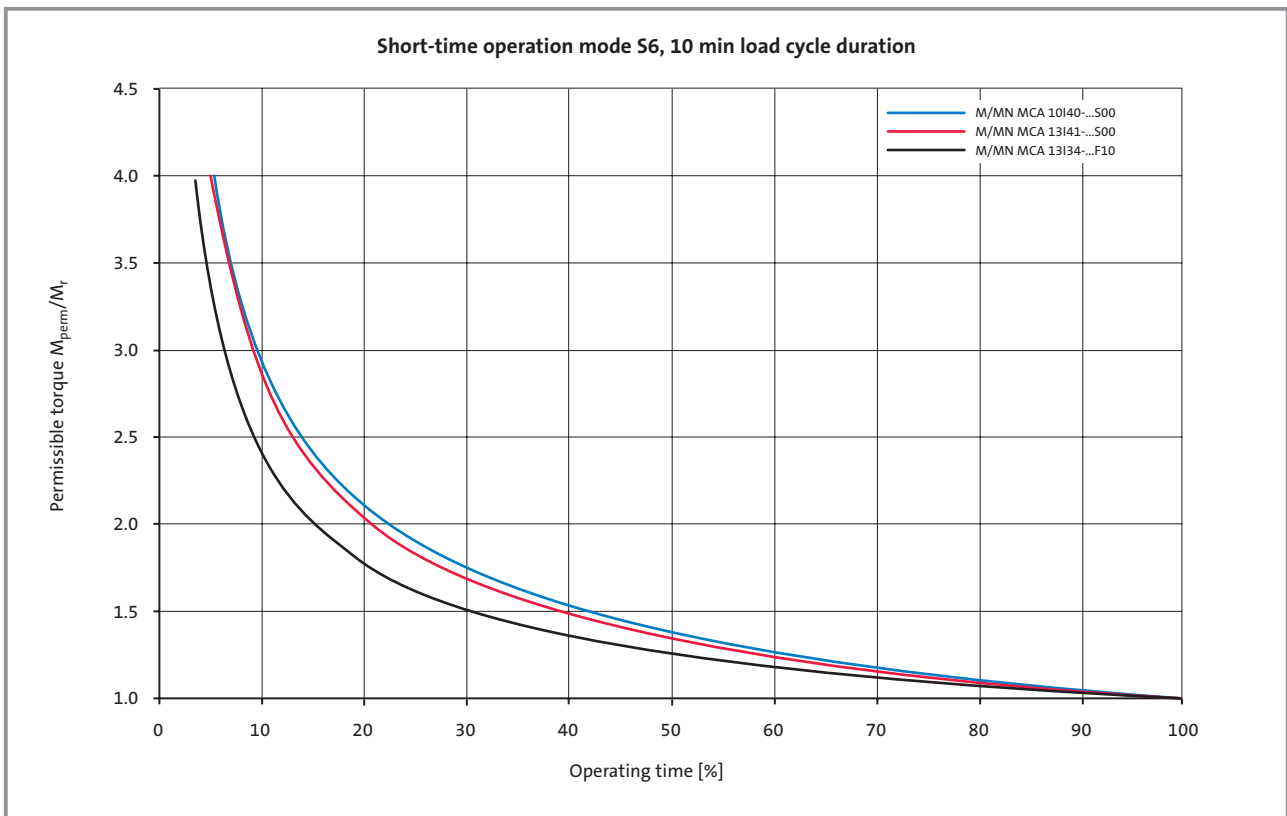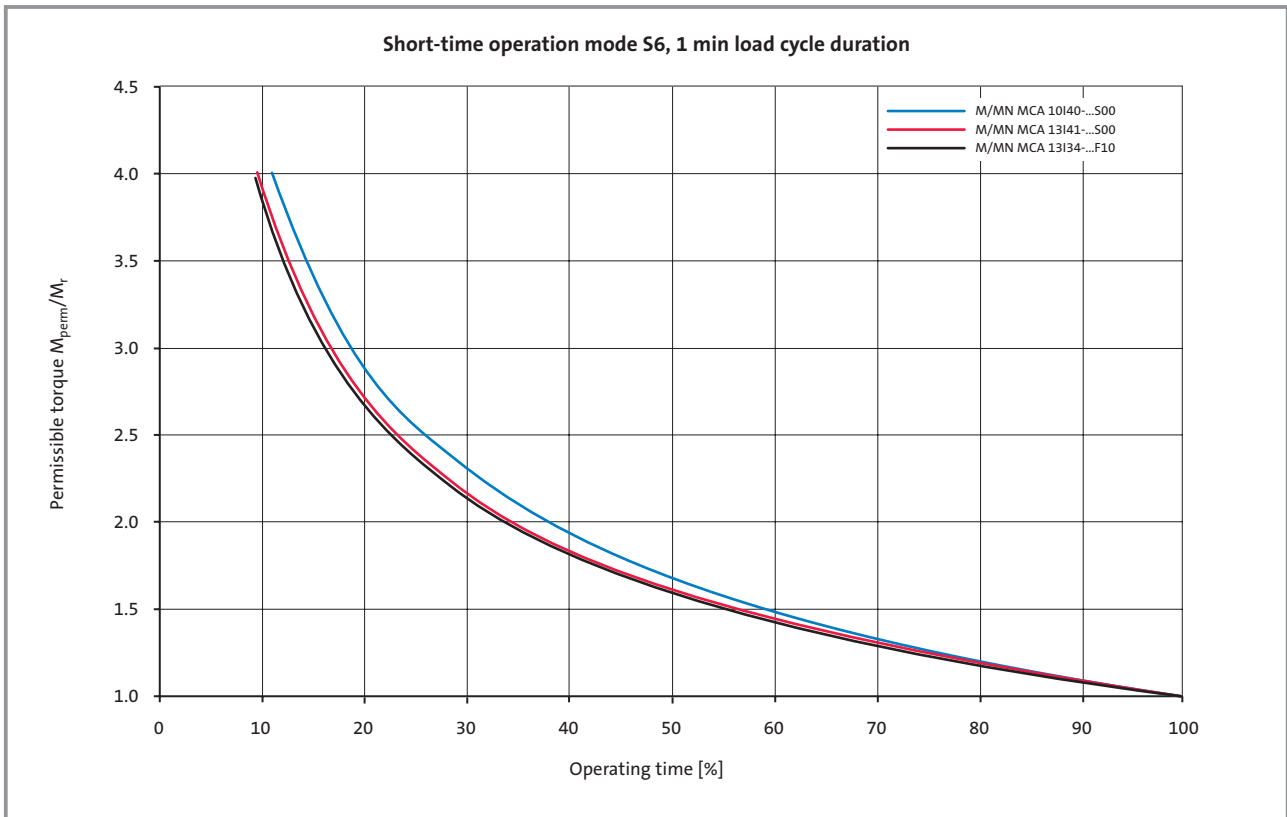


Torque characteristics

MCA 14L41...S00

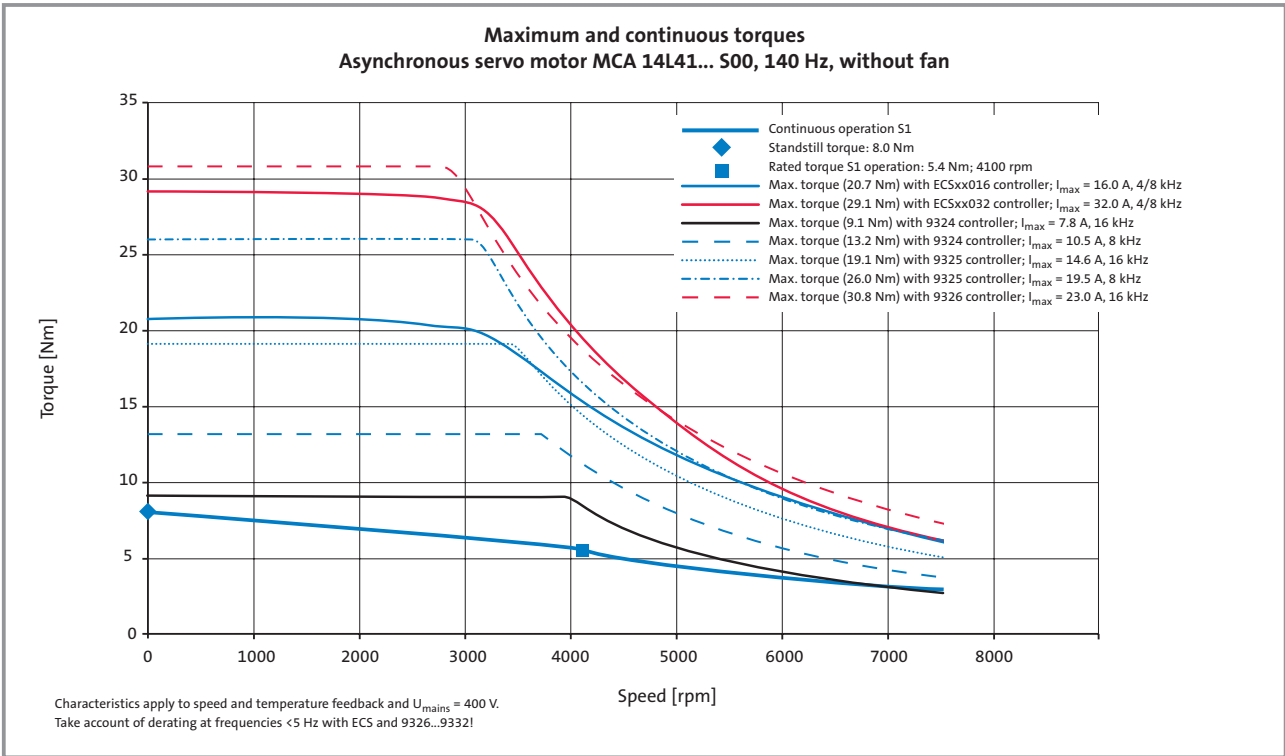


MCA 14L20...S00

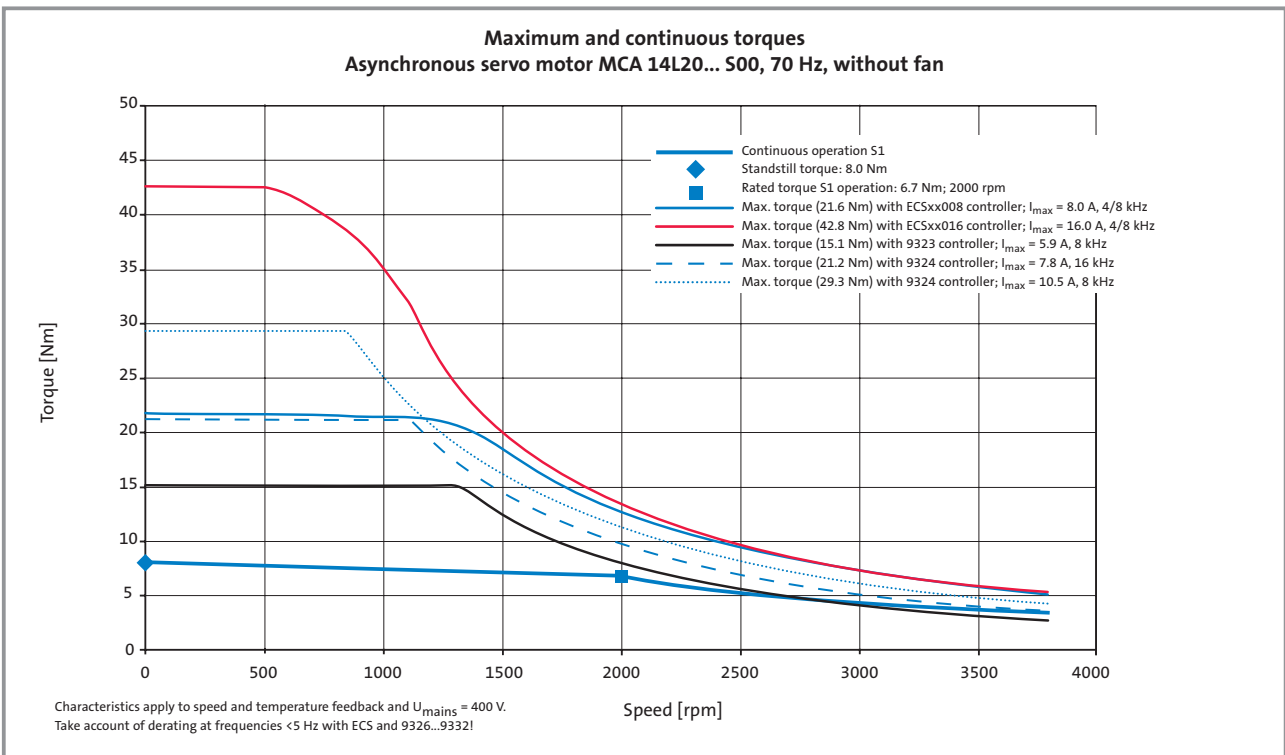




Torque characteristics

MCA 14L35...F10

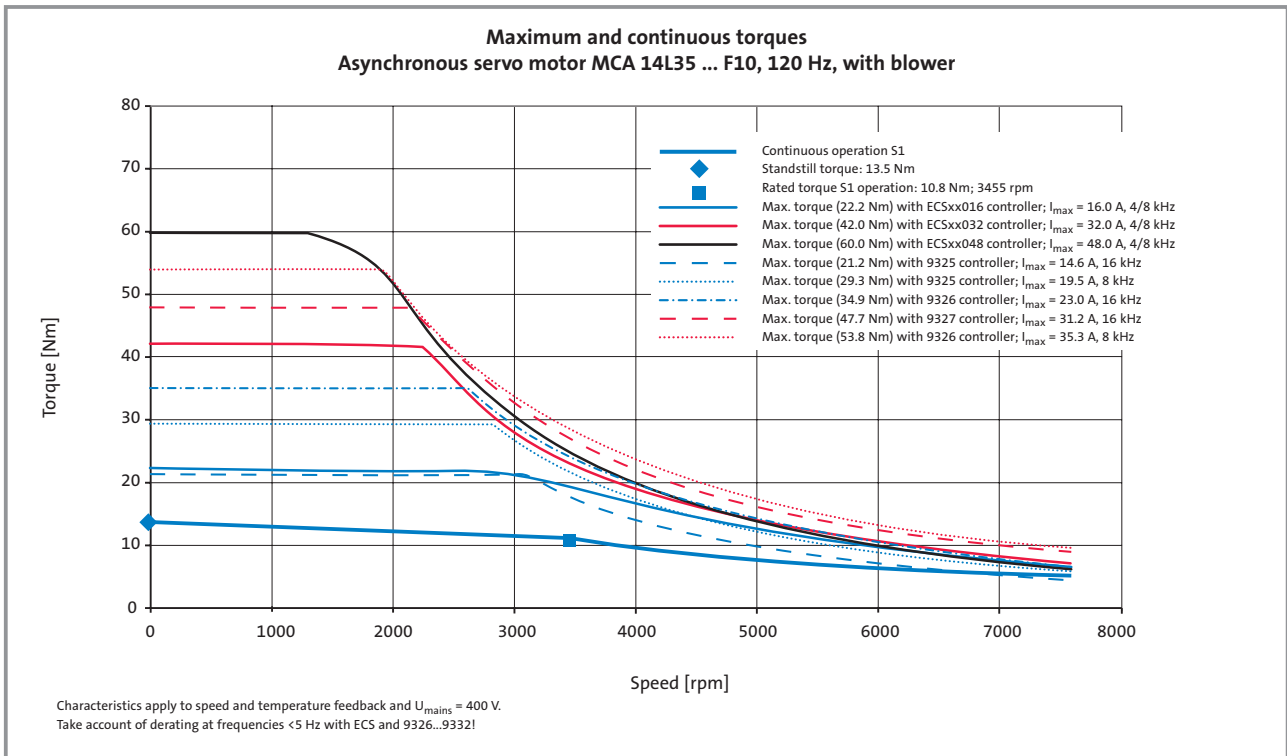


MCA 14L16...F10


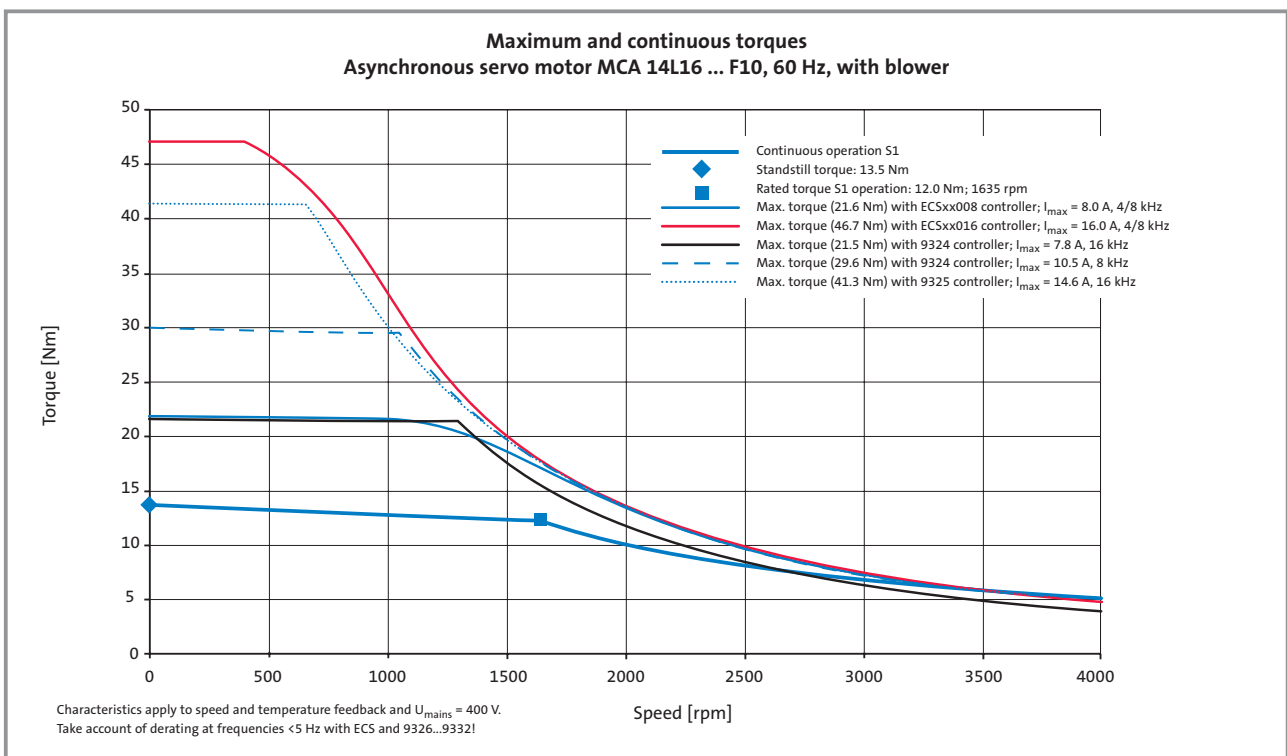


Short-time operation characteristic

Lenze MCA servo motors have high torque peaks. In order to make full use of this highly dynamic response as simply as possible, the following diagrams for operating modes S2


and S6 illustrate the permissible operating times against the torque peaks required.

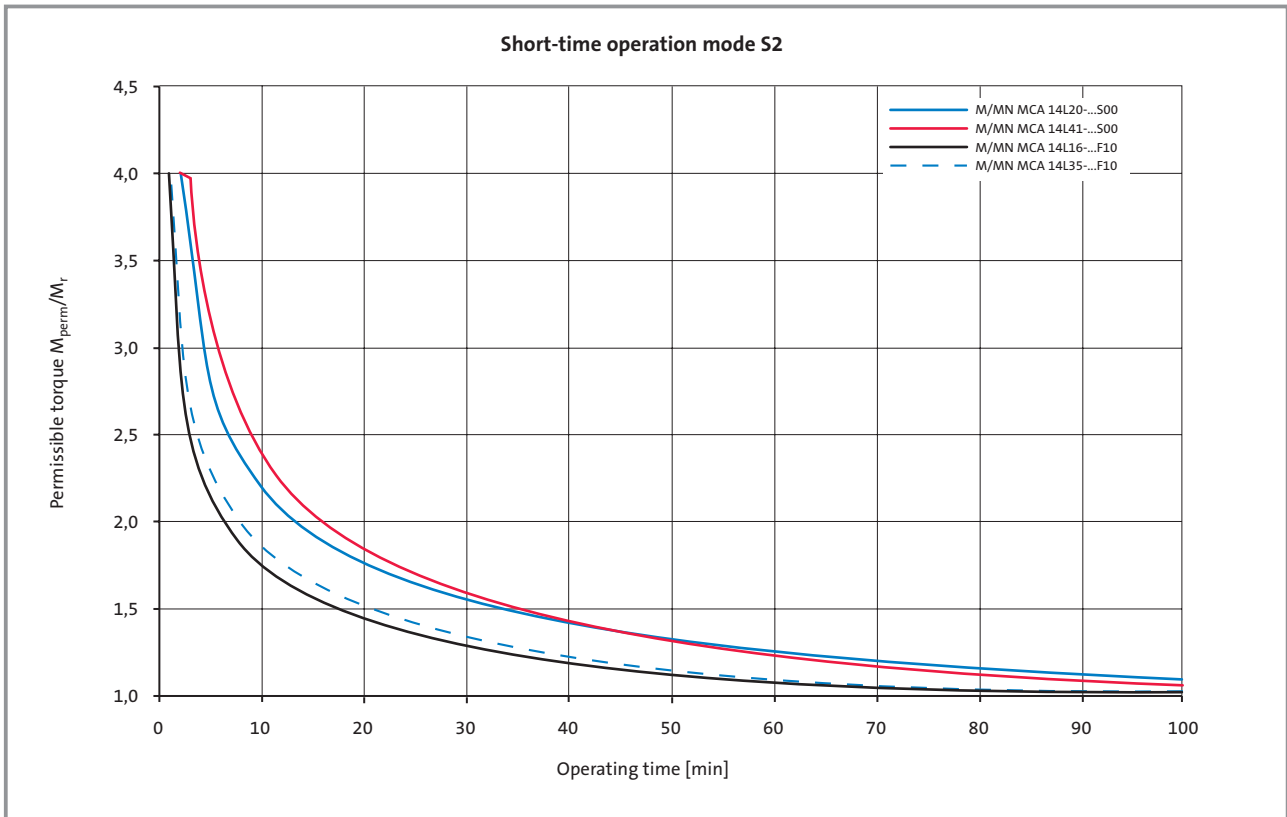

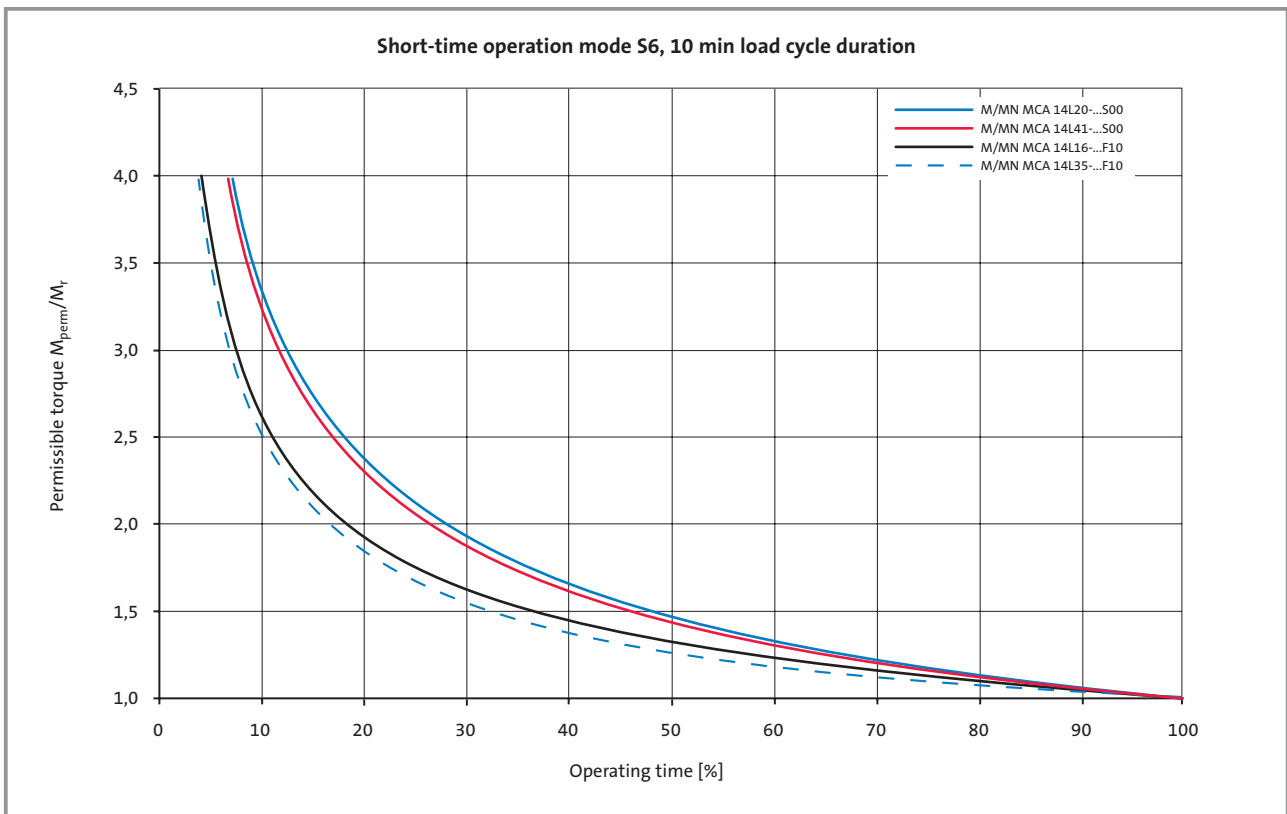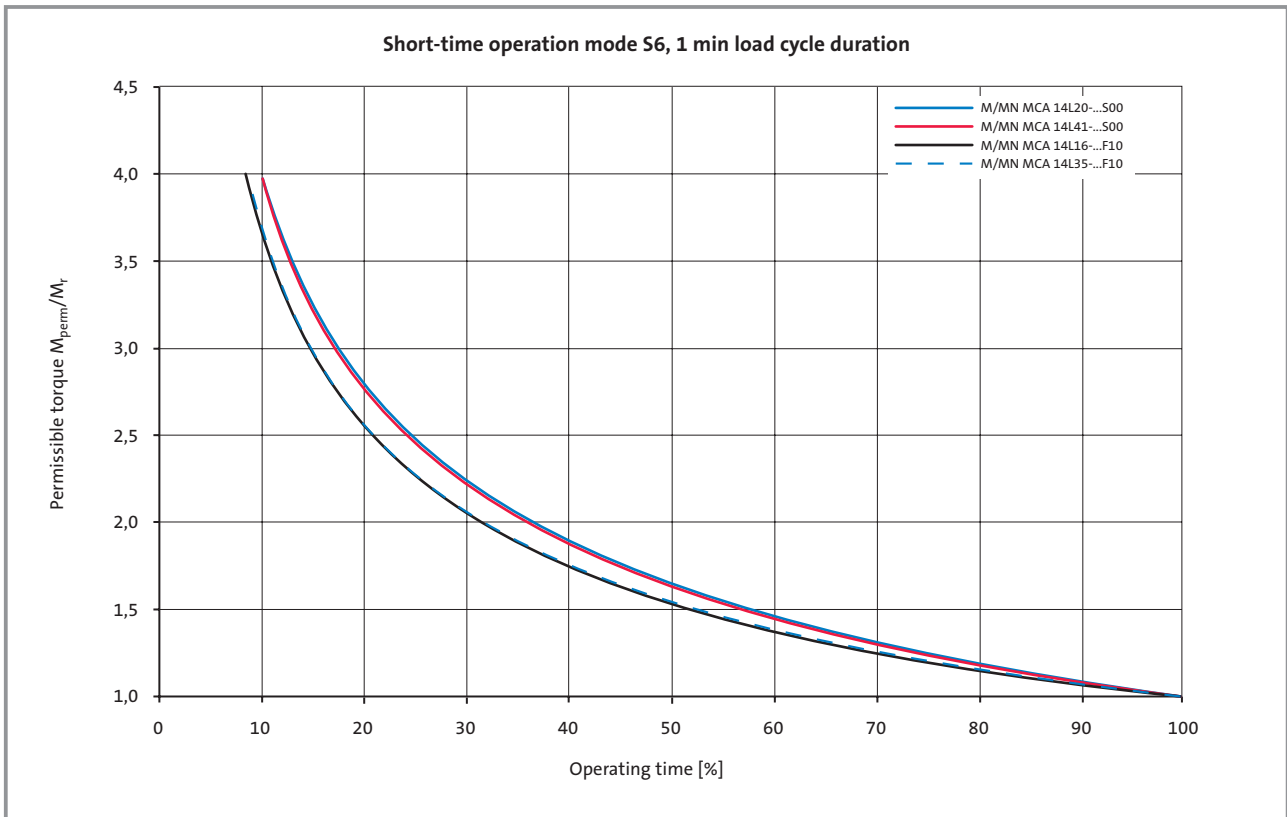


Torque characteristics

MCA 17N41...S00

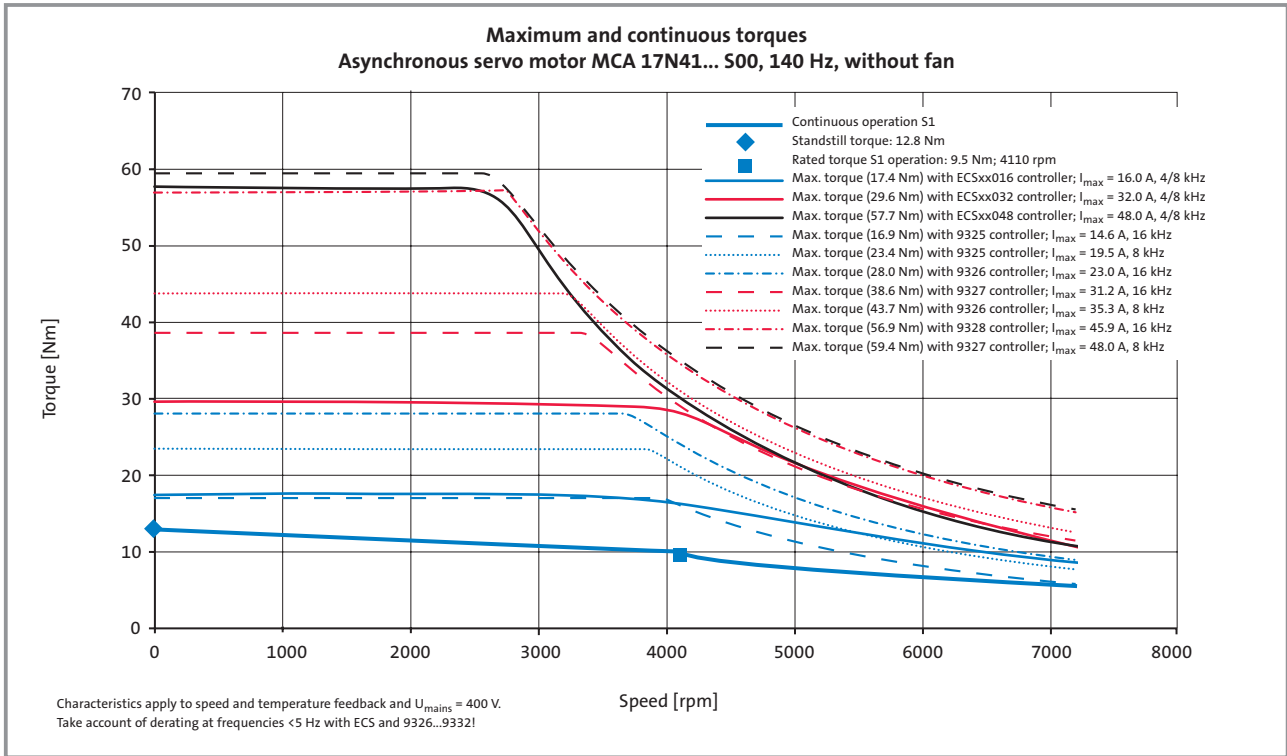


MCA 17N23...S00

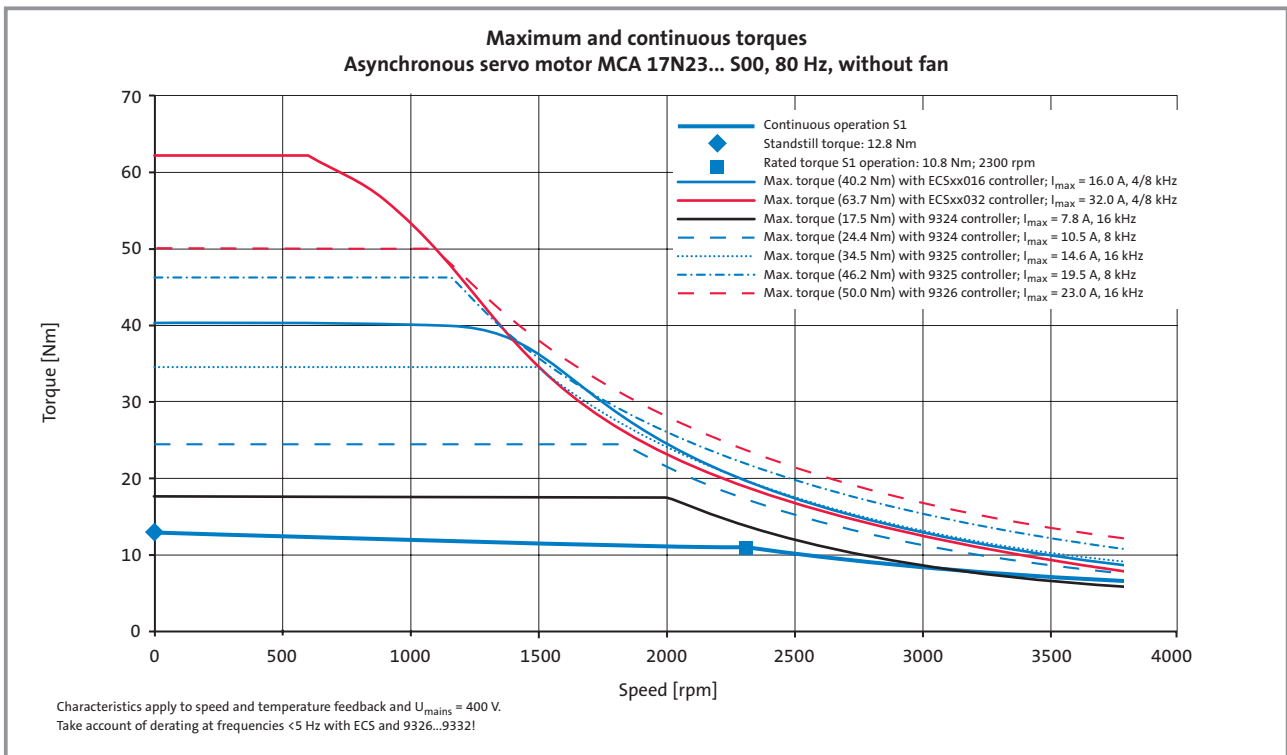




Torque characteristics

MCA 17N35...F10

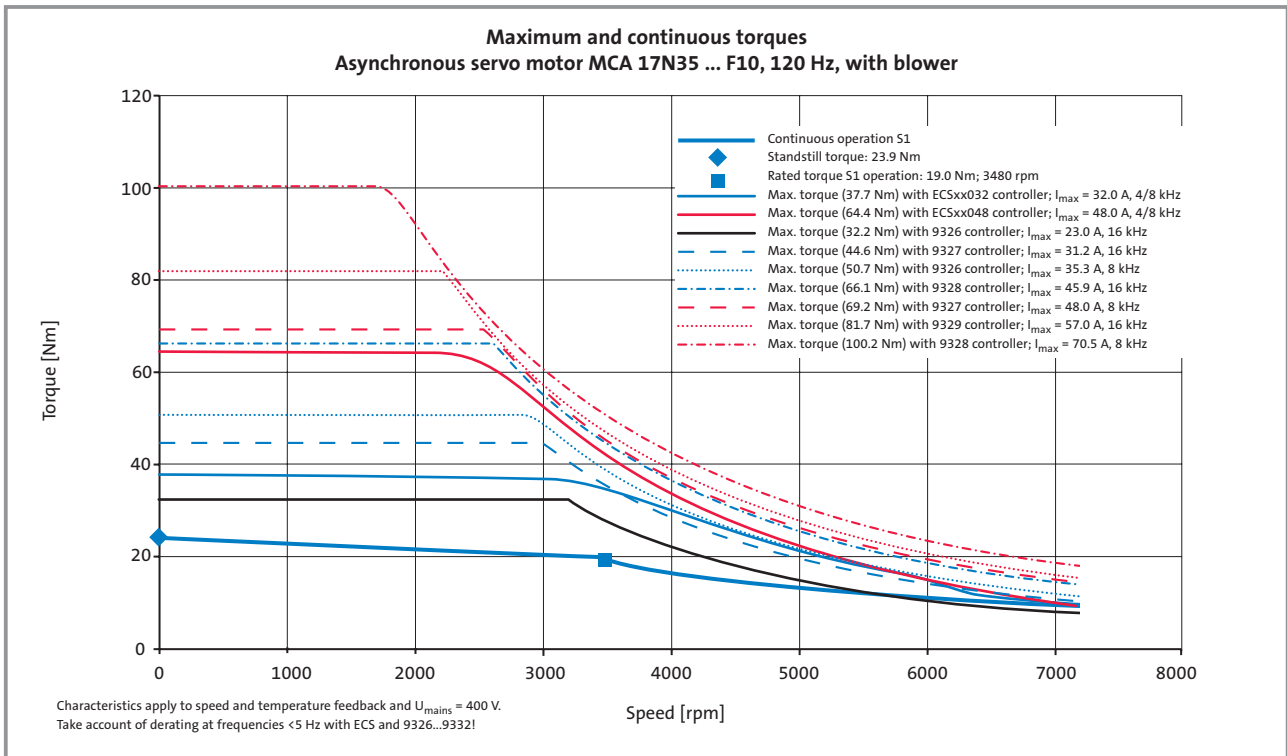


MCA 17N17...F10

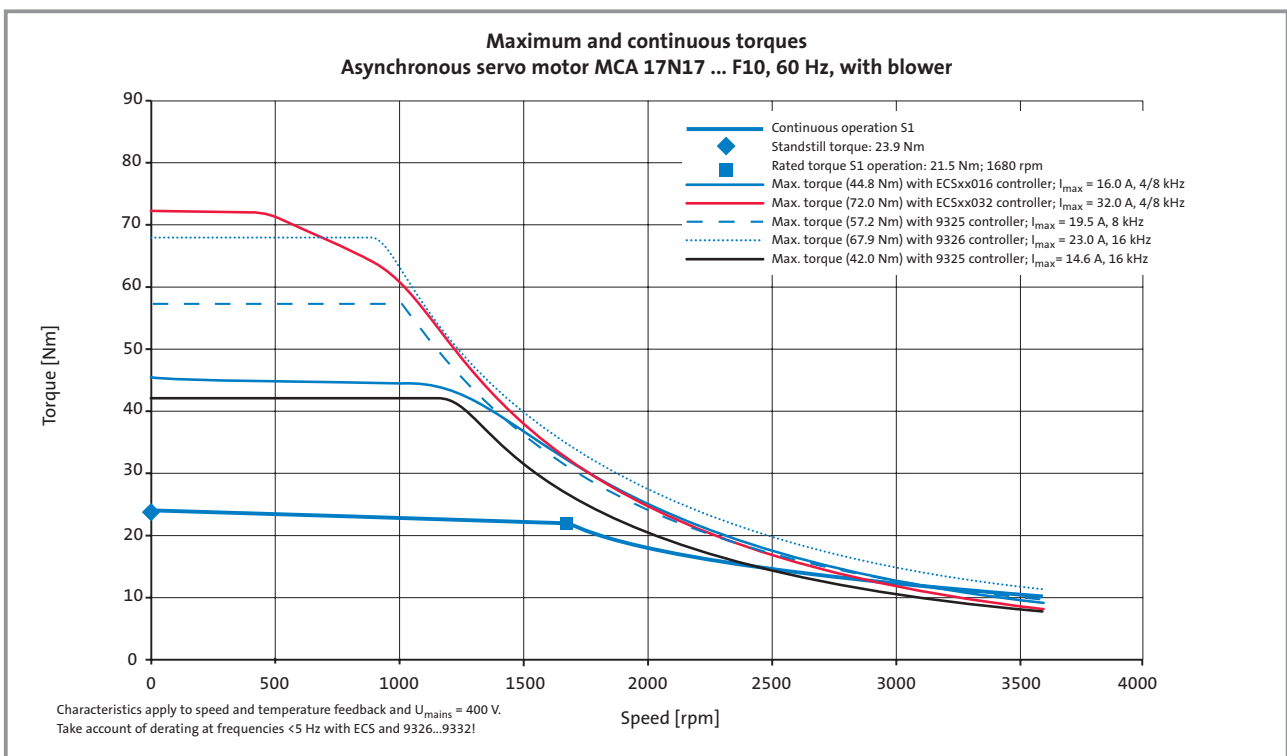


Short-time operation characteristic

Lenze MCA servo motors have high torque peaks. In order to make full use of this highly dynamic response as simply as possible, the following diagrams for operating modes S2


and S6 illustrate the permissible operating times against the torque peaks required.

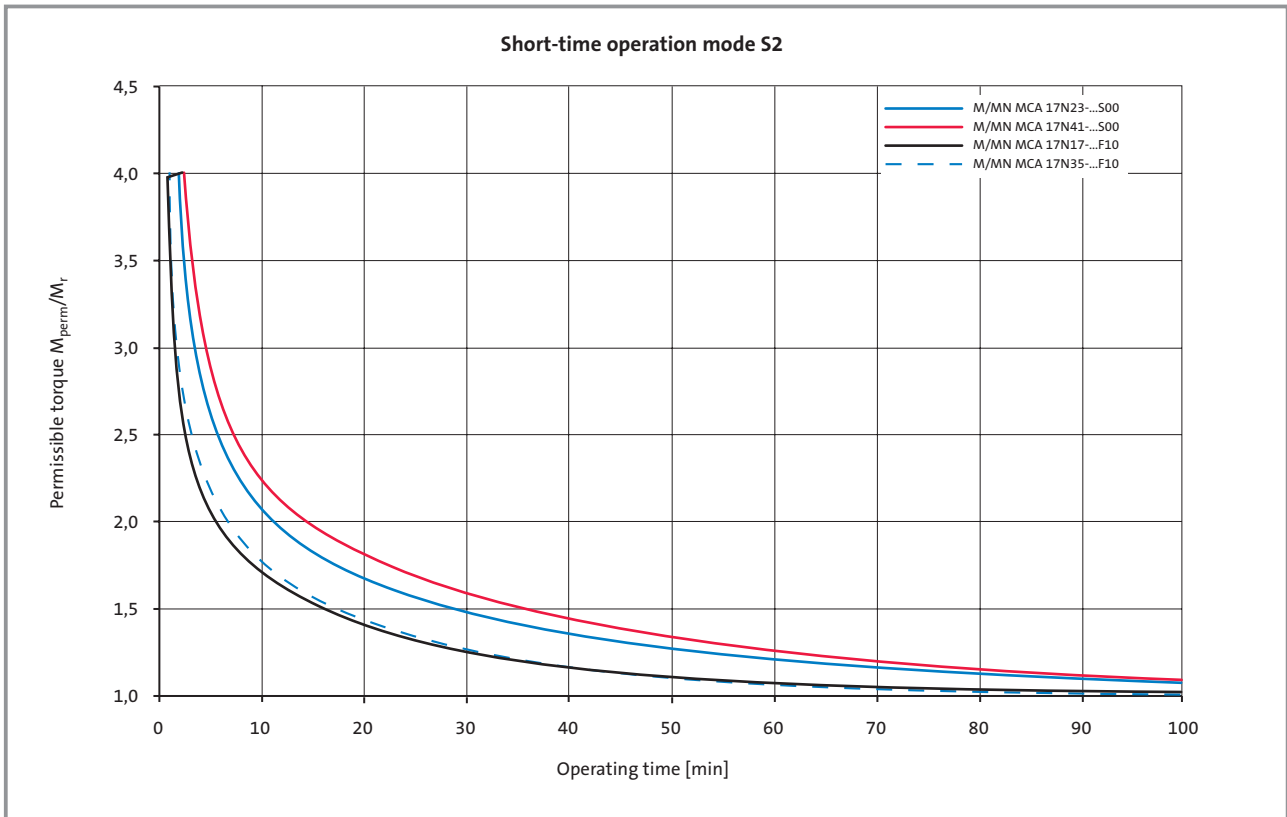

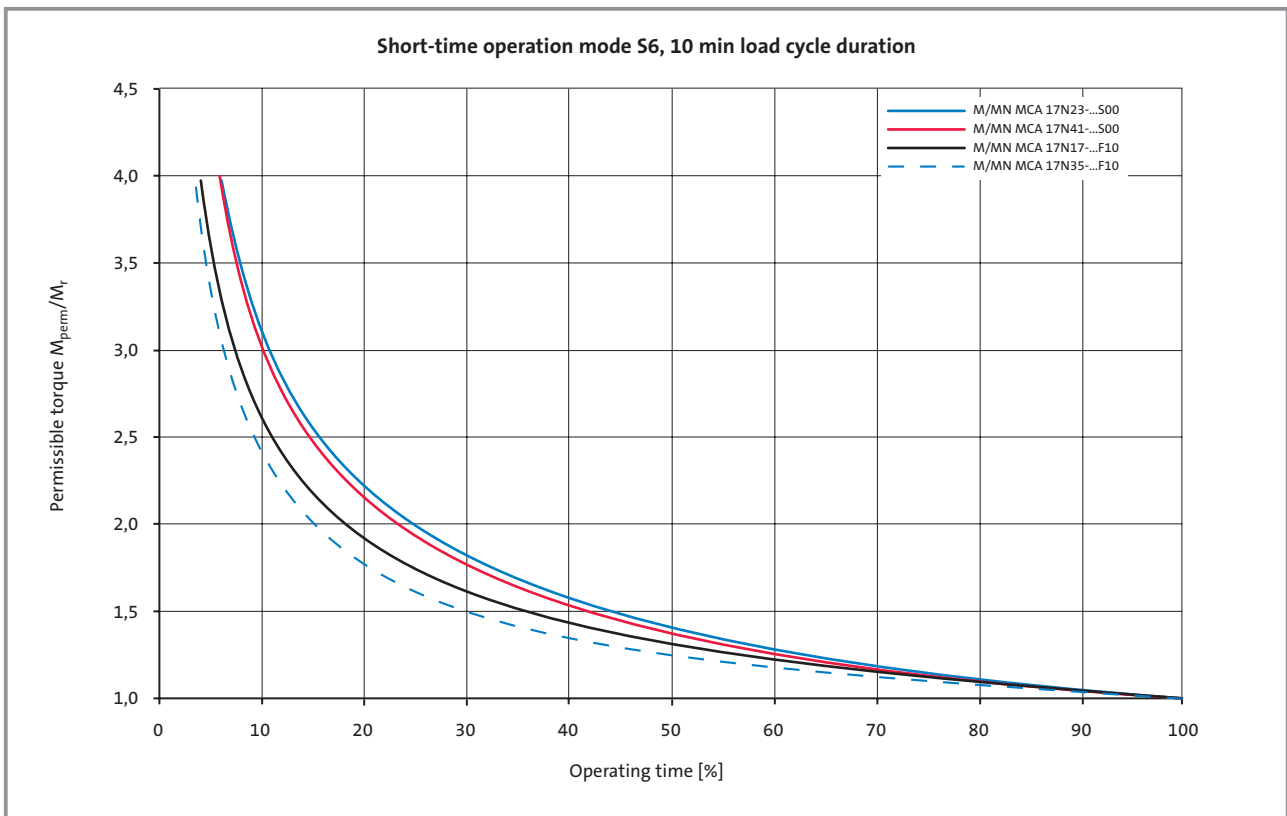


Torque characteristics

MCA 19S42...S00

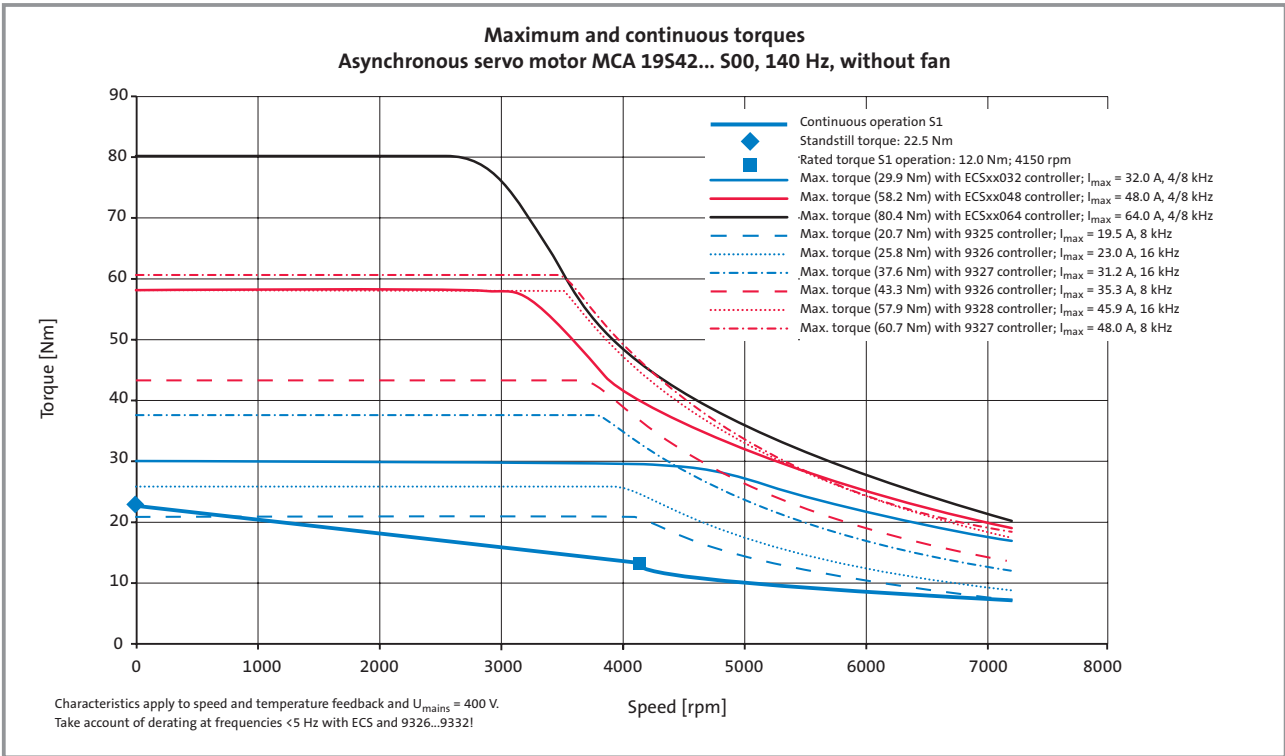


MCA 19S40...S00

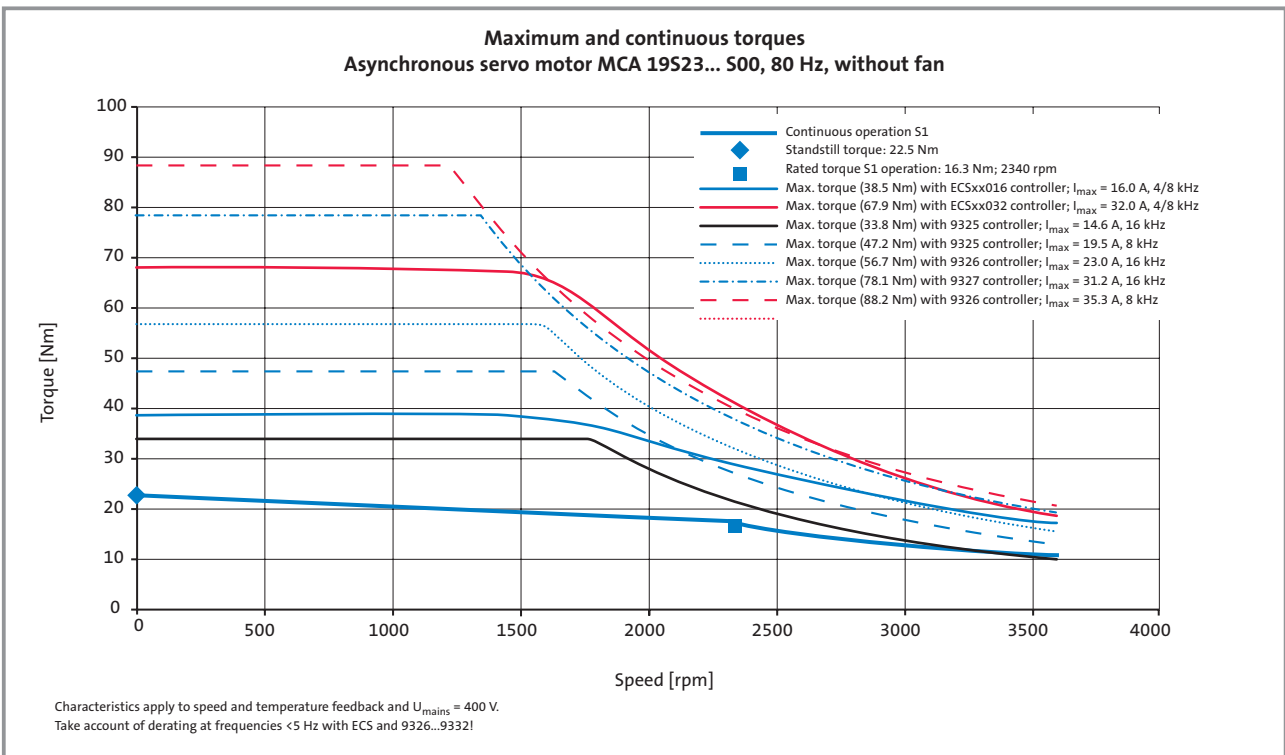




Torque characteristics

MCA 19S35...F10

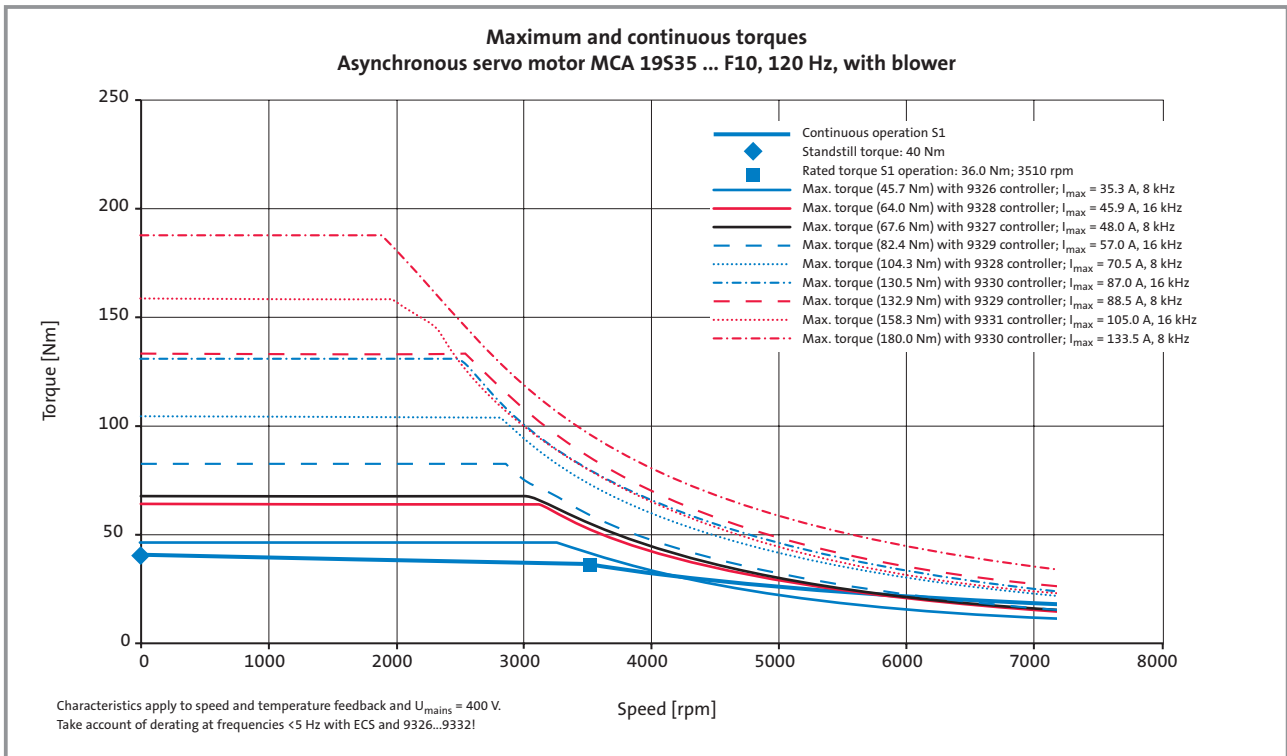


MCA 19S17...F10


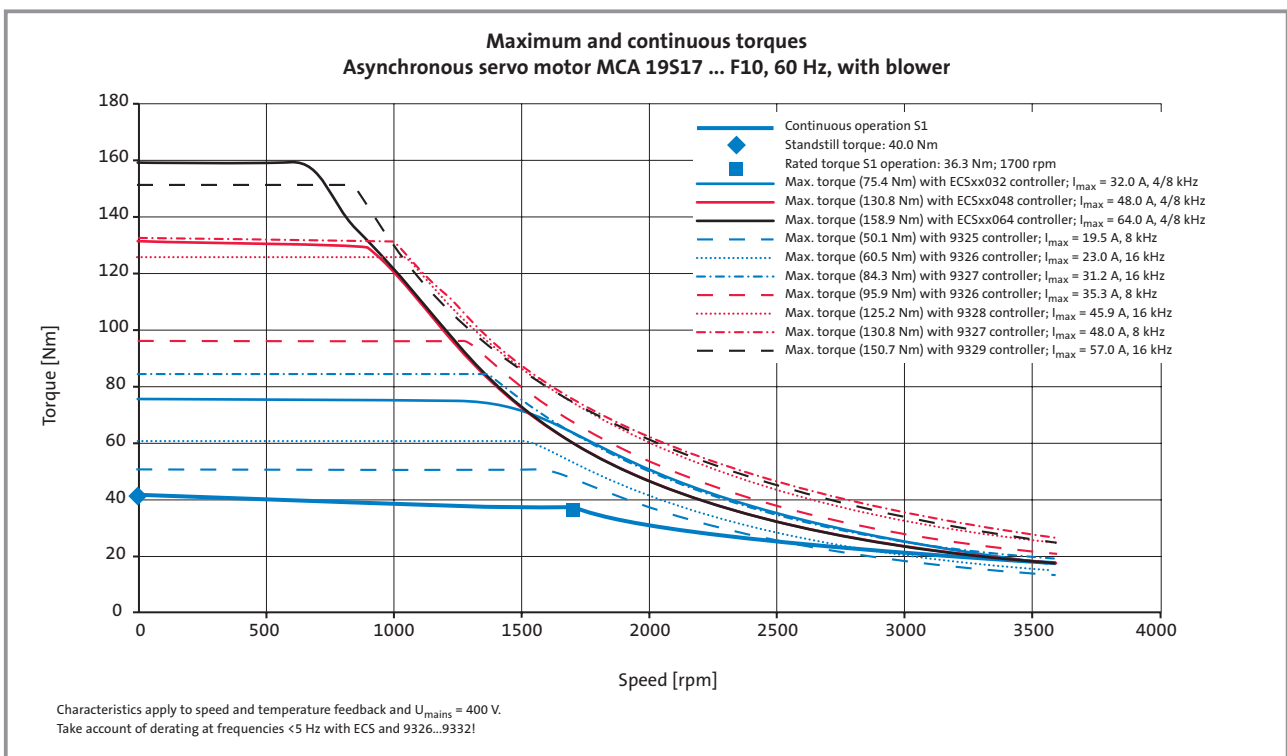


Short-time operation characteristic

Lenze MCA servo motors have high torque peaks. In order to make full use of this highly dynamic response as simply as possible, the following diagrams for operating modes S2


and S6 illustrate the permissible operating times against the torque peaks required.

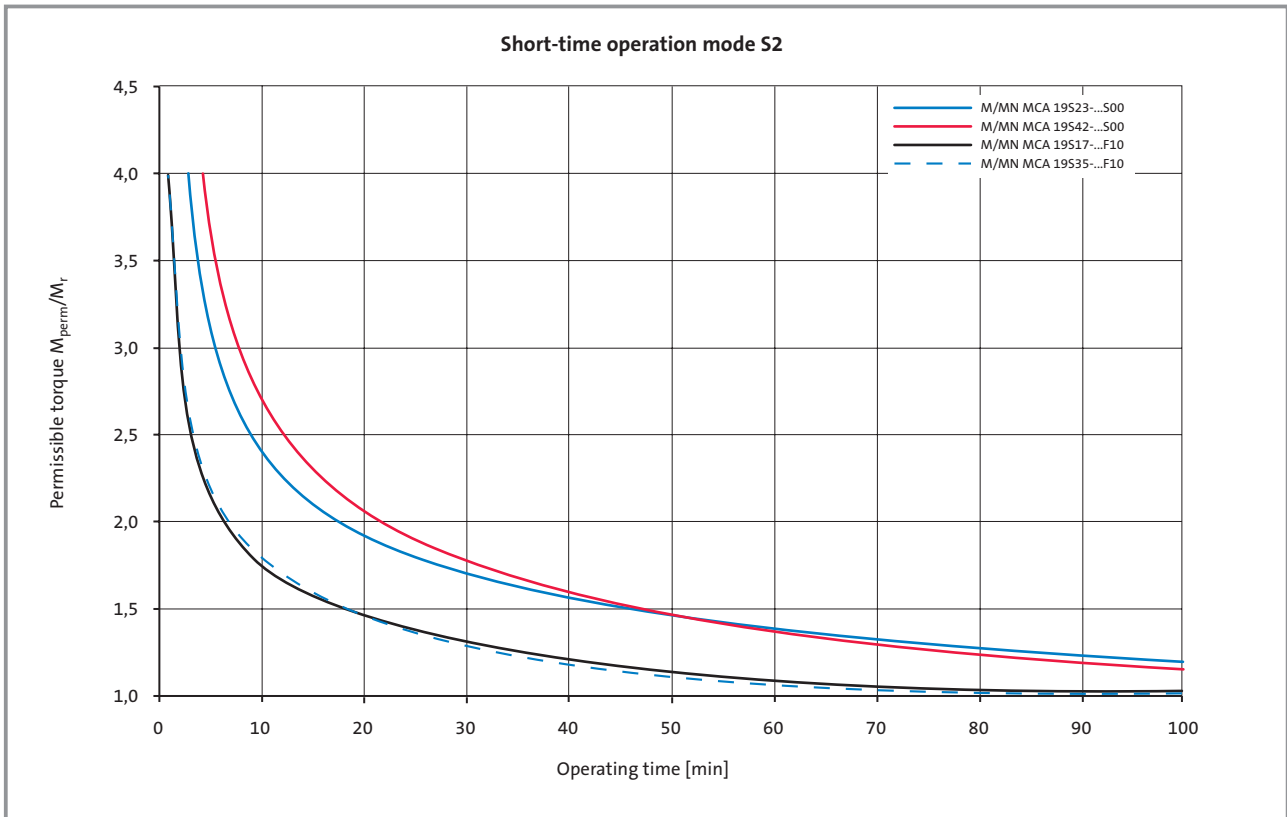

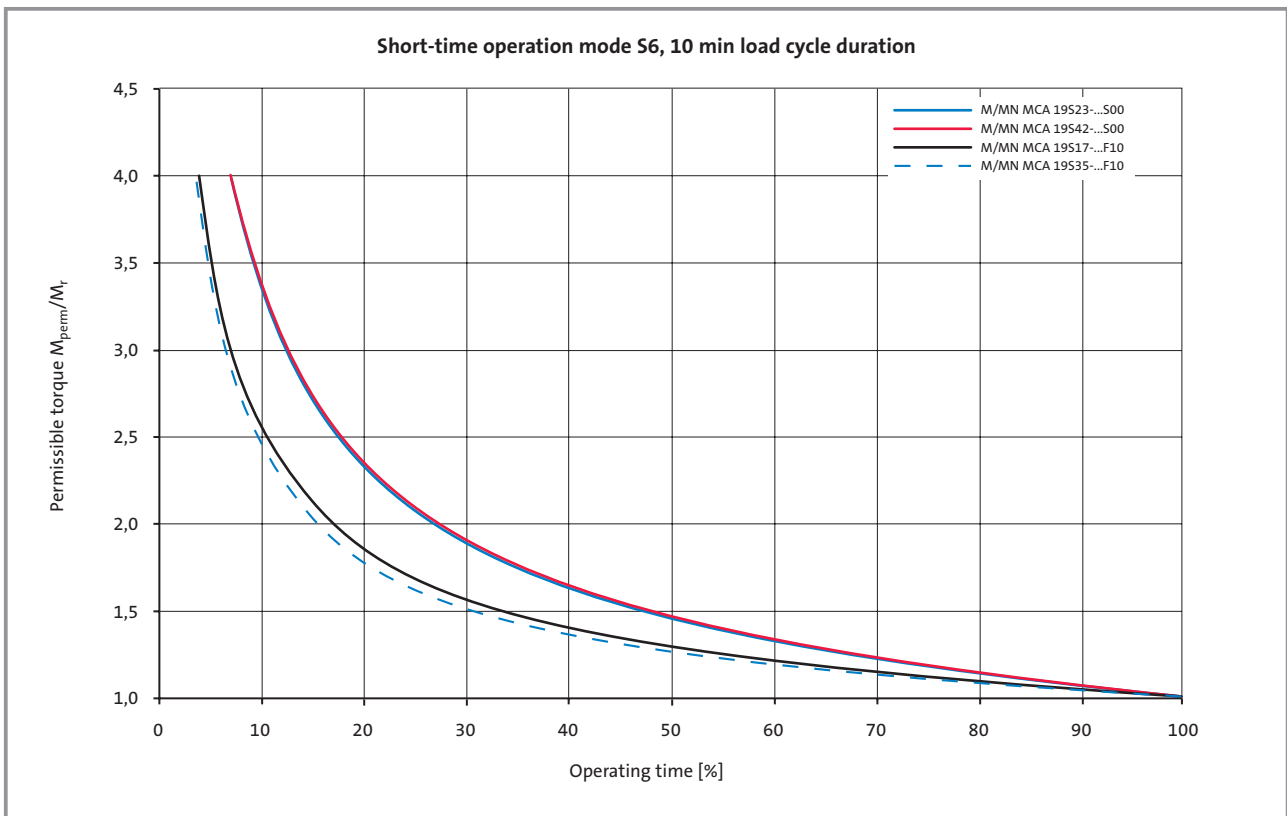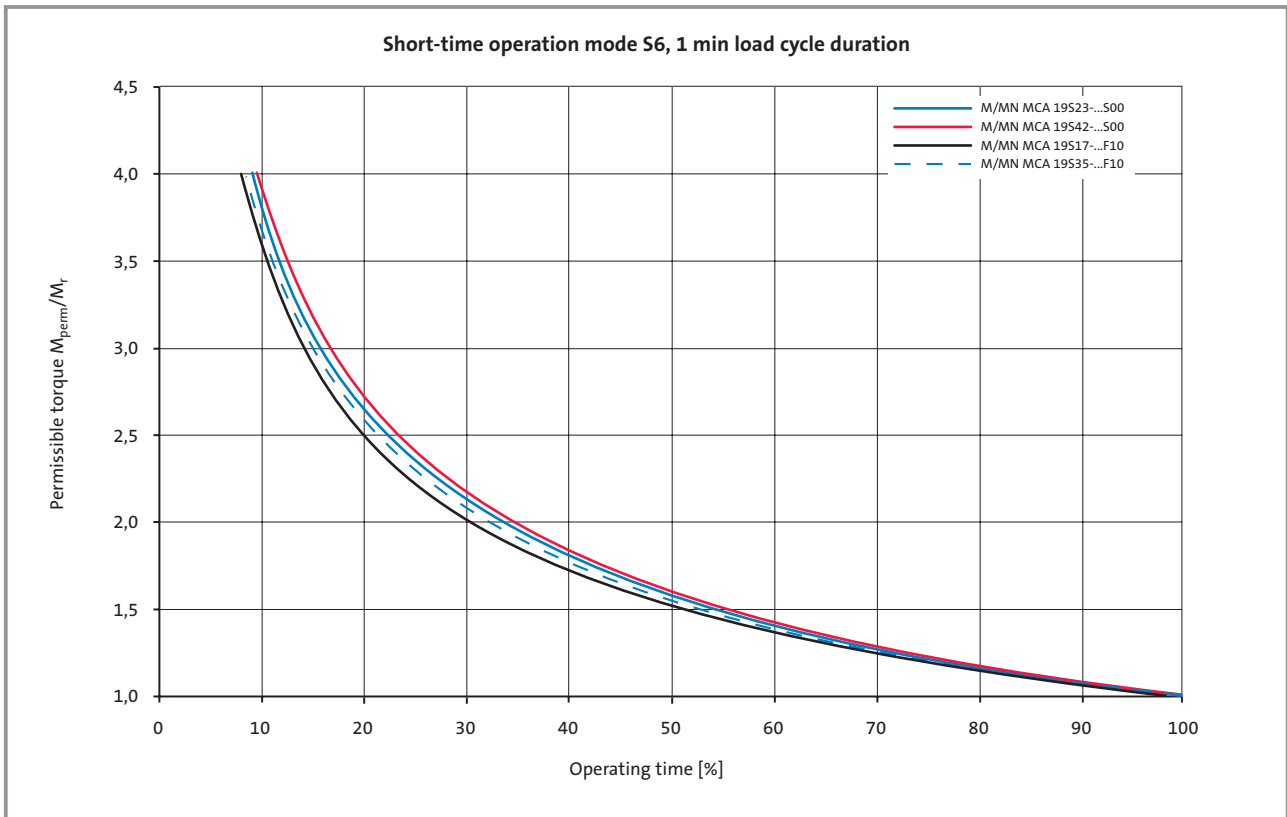


Torque characteristics

MCA 21X42...S00

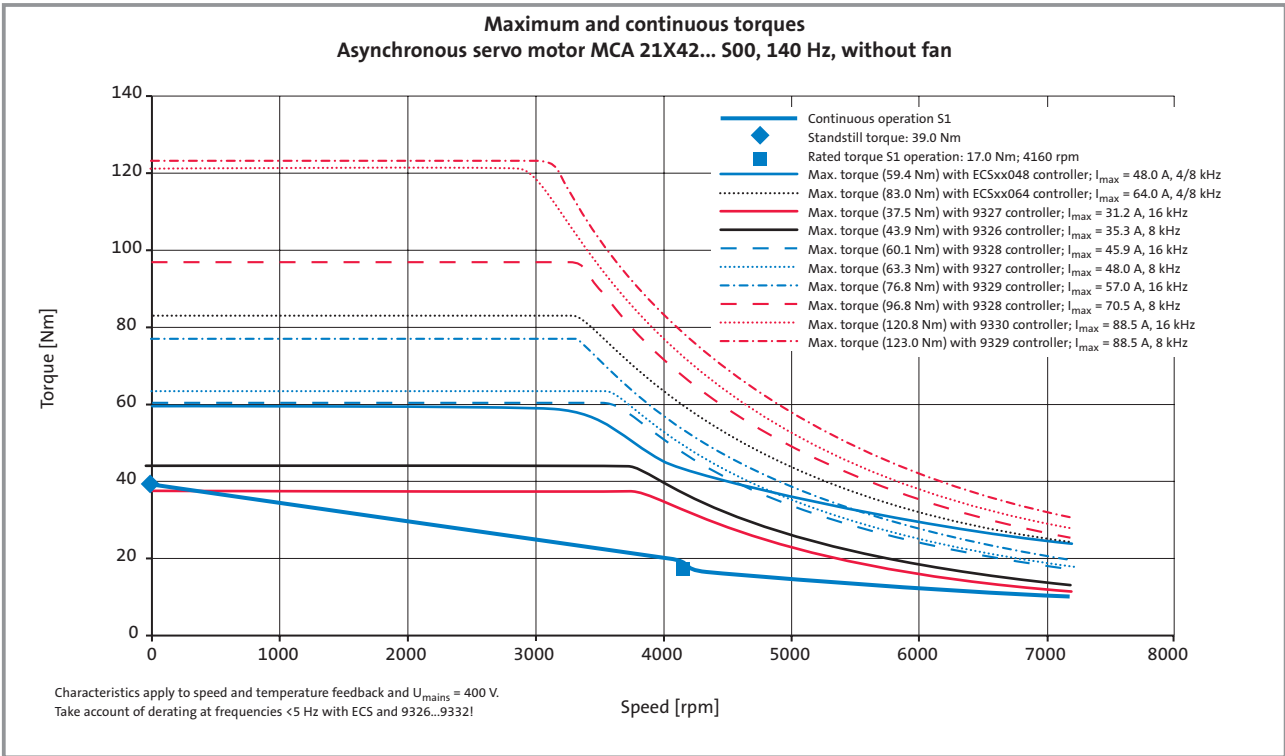


MCA 21X25...S00

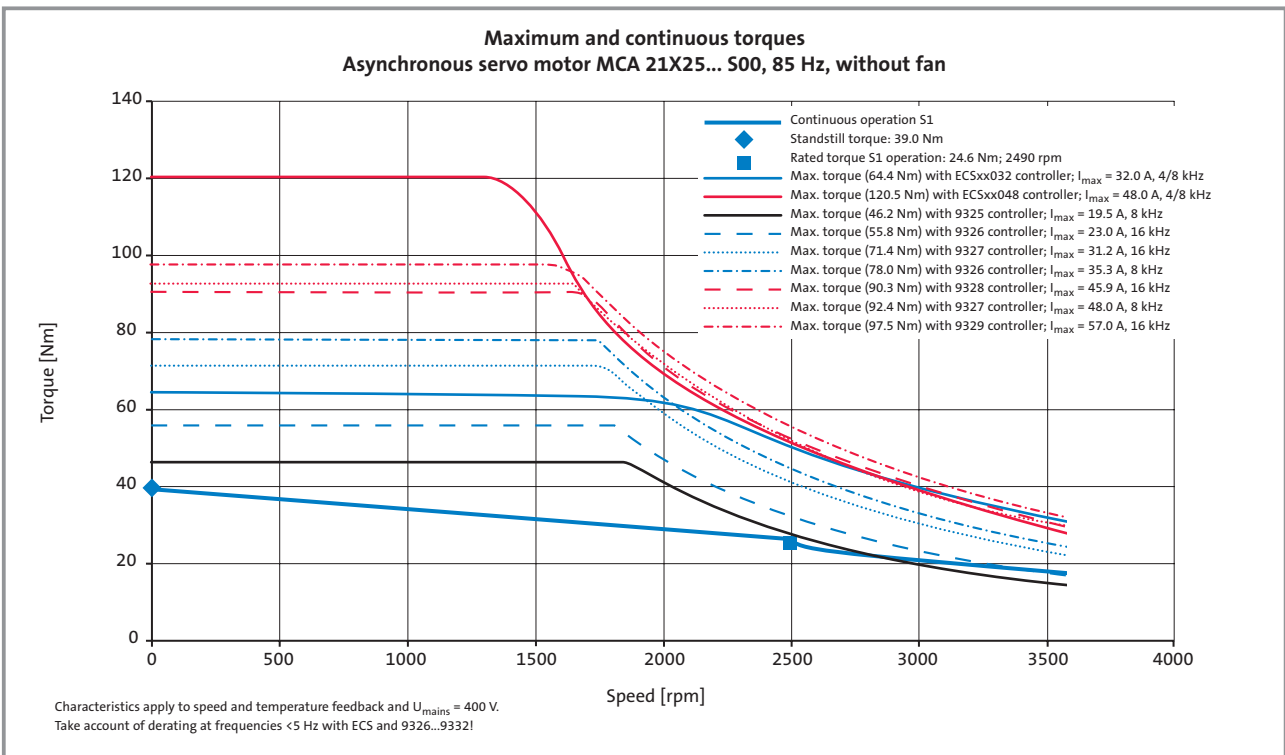




Torque characteristics

MCA 21X35...F10

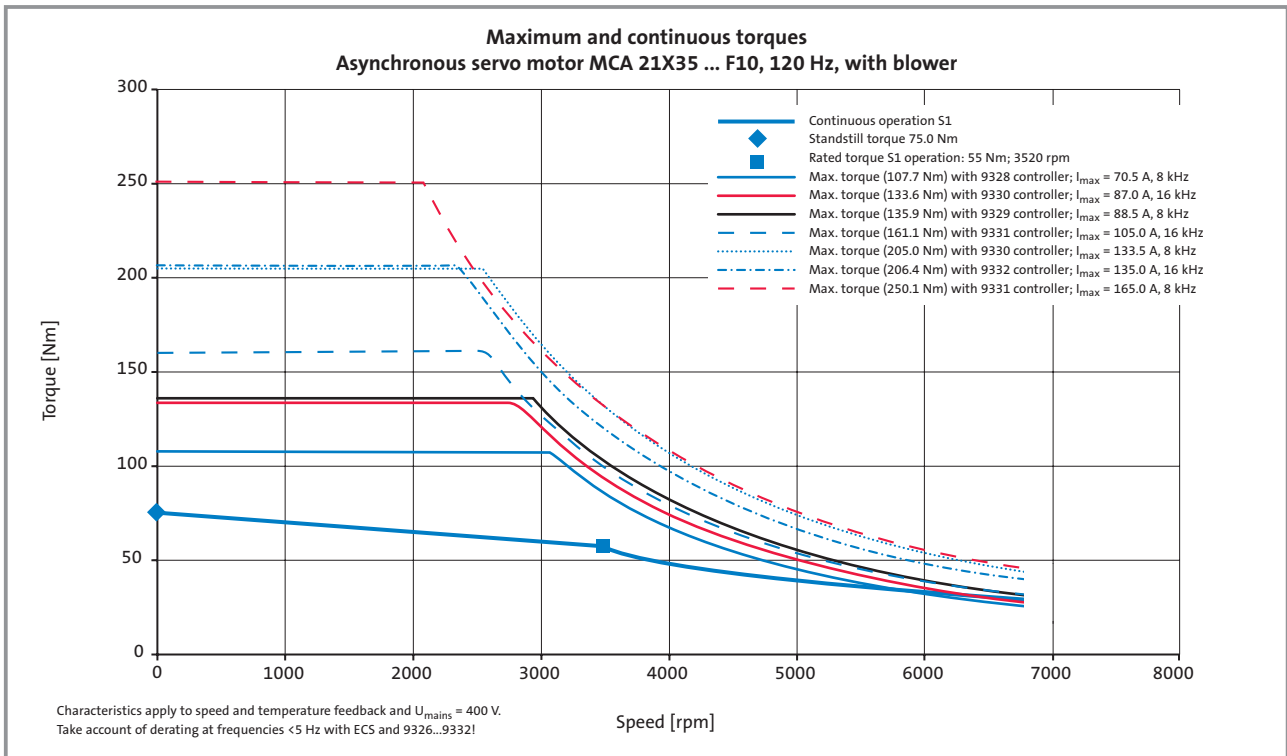

MCA 21X17...F10

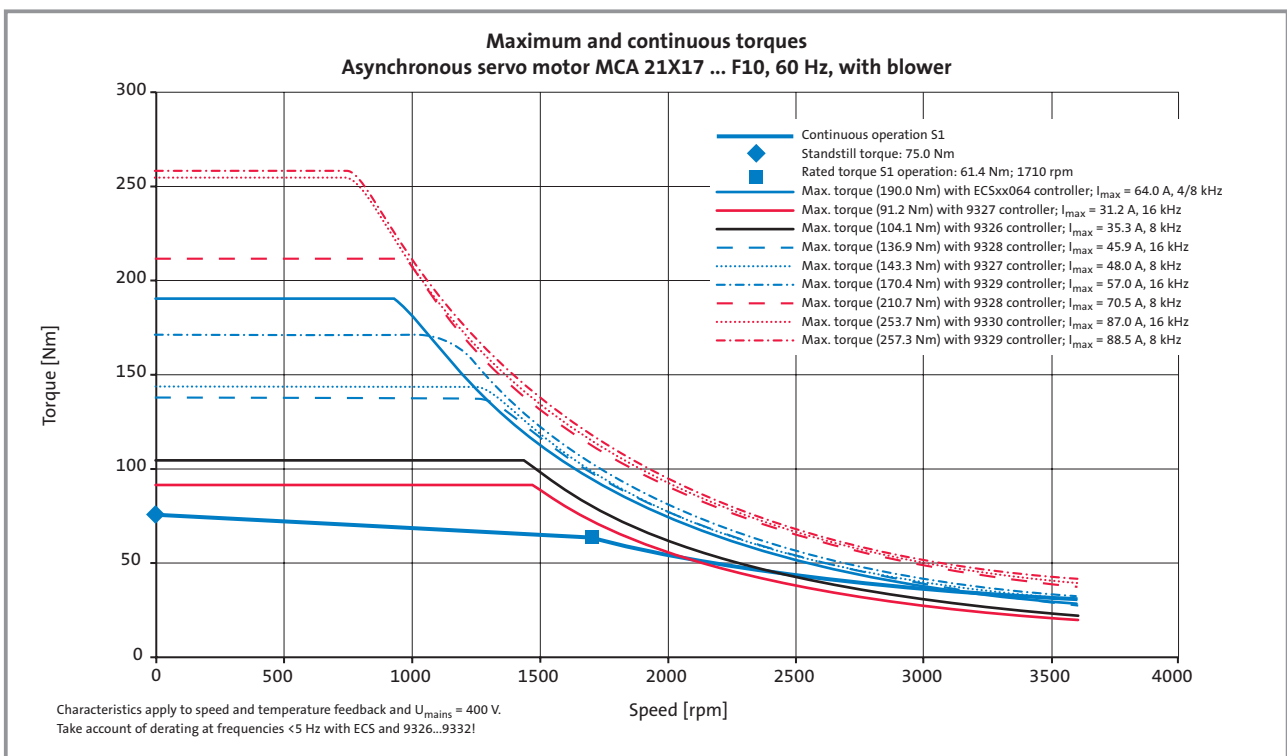

Short-time operation characteristic

Lenze MCA servo motors have high torque peaks. In order to make full use of this highly dynamic response as simply as possible, the following diagrams for operating modes S2

and S6 illustrate the permissible operating times against the torque peaks required.

